

# Manhole Inspection Summary

Manhole # S09EE2022MH

Printed On: 12/17/2008

Page 1 of 4

**Inspection** ☐ Is Incomplete Rating: **2) Good**

Record Plat: **09EE2** Node: **022** Status: **Found**

Insp Date: **9/26/06 1:55 PM**

Incomplete Comments

Crew: **HDP, JY**  
Inspector: **Jensen, J**  
Firm: **RKK**

**Location** Address: **6225 PIMILICO RD**

Cross Street: **STEELE RD**

**Manhole** Type: **Junction**

Location: **Woods**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments

**Cover**

Shape: **Circular**

Diameter: **30** (in.) Length: (in.) Dist A/B Grade: **4** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

**Frame**

Offset: **0** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Leaks

**Chimney / Frame Adjustment**

☒ Exists Material: **Brick**

☐ Parged Height: **24** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☒ **Mortar** ☐ Roots ☐ Wall

**Corbel**

Material: **Precast Concrete**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Barrel**

Material: **Precast Concrete**

☐ Parged

Shape: **Circular**

Diameter: **48** (in.) Length: (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Bench**

☒ Exists Material: **Brick**

☐ Parged ☐ Debris (not Condition related)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Channel**

Material: **Brick**

☐ Parged

☒ **Debris** (not Condition related)

Channel Exposure: **Fully Open** Junc Dist: **1** nearest .5 ft. Azimuth: **-1**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Steps**

Count: **12** Missing: **0** ☐ Corroded

**Surcharge**

☐ Evidence Of Surcharge

Depth: (ft.)

☐ Active Surcharge Present

# Manhole Inspection Summary

Manhole # S09EE2022MH

Printed On: 12/17/2008

Page 2 of 4

Location View



Location View



Location View



Top View



Defect



Adjustment infiltration.

## Manhole Inspection Summary

Manhole # S09EE2022MH

Printed On: 12/17/2008

Page 3 of 4

### 8 in. Circular Gravity Sewer Pipe Out @ 12 O'Clock



Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **13.79** (ft.) Flow Characteristics: **None**

Deposits: ☐ None ☐ Mud ☐ Sludge ☒ **Debris** ☐ Grease

Silt Depth: **2** (in.) Deposits Extent: **Medium**

Infiltration: **Evidence** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

### 8 in. Circular Gravity Sewer Pipe In @ 3 O'Clock



Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **13.51** (ft.) Flow Characteristics: **None**

Deposits: ☒ **None** ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **Evidence** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

# Manhole Inspection Summary

Manhole # S09EE2022MH

Printed On: 12/17/2008


Page 4 of 4

## 8 in. Circular Gravity Sewer

Pipe In @ 6 O'Clock



Drop In @ 6 O'Clock

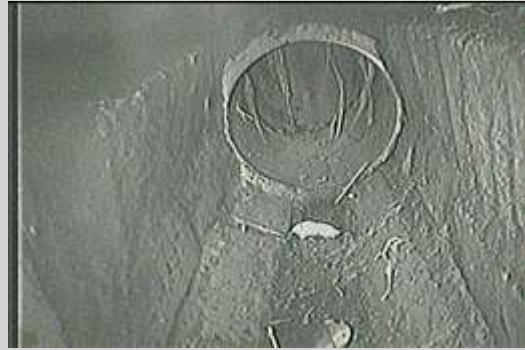

Rod and Bar (Angled)

Pipe Material: **Clay**

☐ Pipe Lined

Invert Depth: **7.28** (ft.) Flow Characteristics: **None**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None**

Pipe Seal Cond: **Roots**

Drop: **Outside** Rod and Bar

Angled: **Yes** Reading: **12.70** (ft.)

Inv Depth: **13.70** (ft.)

Drop Condition: **Open**

Connects To: **Dead End**

☐ Possible Illicit Connection